Bioengineering 280A
Principles of Biomedical Imaging

Fall Quarter 2004
Lecture 5
Sampling

Topics

1. Overview of Sampling
2. 1D Sampling
3. 2D Sampling
4. Aliasing

Analog vs. Digital

The Analog World:
Continuous time/space, continuous valued signals or images, e.g. vinyl records, photographs, x-ray films.

The Digital World:
Discrete time/space, discrete-valued signals or images, e.g. CD-Roms, DVDs, digital photos, digital x-rays, CT, MRI, ultrasound.

The Process of Sampling

$g(x)$

Δx

sample

$g[n]=g(n\ \Delta x)$
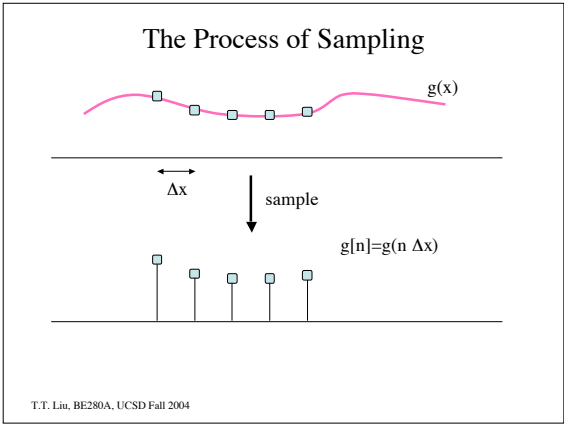
Questions

How finely do we need to sample?

What happens if we don't sample finely enough?

Can we reconstruct the original signal or image from its samples?

Sampling in the Time Domain

Signal at FS

Power Spectrum

Signal at FS/8

Power Spectrum at FS/8
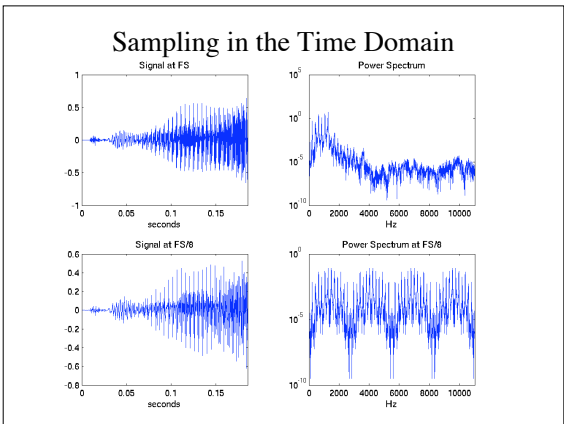
Sampling in Image Space
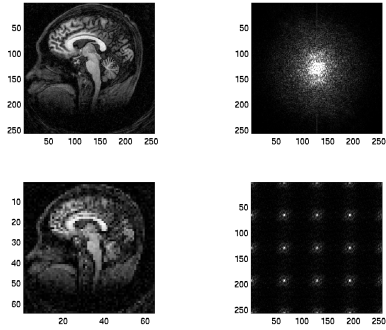
Sampling in k-space
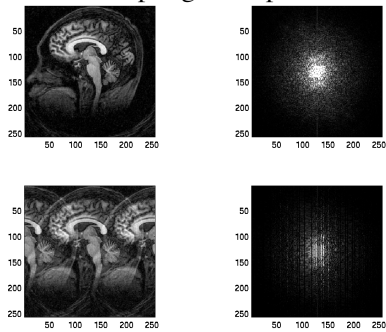
Sampling in k-space
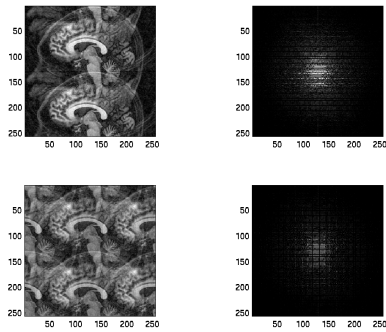
Comb Function

$$comb(x) = \sum_{n=-\infty}^{\infty} \delta(x - n)$$

-5 -4 -3 -2 -1 0 1 2 3 4 5

Other names: Impulse train, bed of nails, shah function.

T.T. Liu, BE280A, UCSD Fall 2004

Scaled Comb Function

$$comb\left(\frac{x}{\Delta x}\right) = \sum_{n=-\infty}^{\infty} \delta(\frac{x}{\Delta x} - n)$$

$$= \sum_{n=-\infty}^{\infty} \delta(\frac{x - n\Delta x}{\Delta x})$$

$$= \Delta x \sum_{n=-\infty}^{\infty} \delta(x - n\Delta x)$$

Δx

T.T. Liu, BE280A, UCSD Fall 2004

1D spatial sampling

$$g_S(x) = g(x)\frac{1}{\Delta x}comb\left(\frac{x}{\Delta x}\right)$$

$$= g(x) \sum_{n=-\infty}^{\infty} \delta(x - n\Delta x)$$

$$= \sum_{n=-\infty}^{\infty} g(n\Delta x)\delta(x - n\Delta x)$$

Recall the sifting property $\int_{-\infty}^{\infty} g(x)\delta(x - a) = g(a)$

But we can also write $\int_{-\infty}^{\infty} g(a)\delta(x - a) = g(a)\int_{-\infty}^{\infty} \delta(x - a) = g(a)$

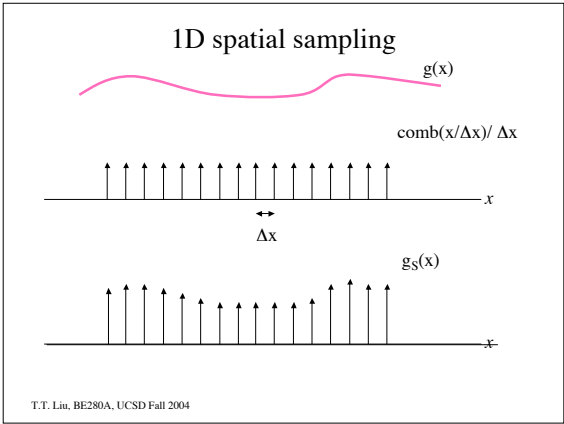So, $g(x)\delta(x - a) = g(a)\delta(x - a)$

T.T. Liu, BE280A, UCSD Fall 2004

1D spatial sampling

g(x)

comb(x/Δx)/ Δx

x

Δx

g$_S$(x)

x

Fourier Transform of comb(x)

$$F[comb(x)] = comb(k_x)$$

$$= \sum_{n=-\infty}^{\infty} \delta(k_x - n)$$

$$F\left[\frac{1}{\Delta x} comb(\frac{x}{\Delta x})\right] = \frac{1}{\Delta x} \Delta x comb(k_x \Delta x)$$

$$= \sum_{n=-\infty}^{\infty} \delta(k_x \Delta x - n)$$

$$= \frac{1}{\Delta x} \sum_{n=-\infty}^{\infty} \delta(k_x - \frac{n}{\Delta x})$$

Fourier Transform of comb(x/ Δx)

comb(x/ Δx)/ Δx

x

Δx

F

1/Δx

comb(k$_x$ Δx)

k_x

1/Δx
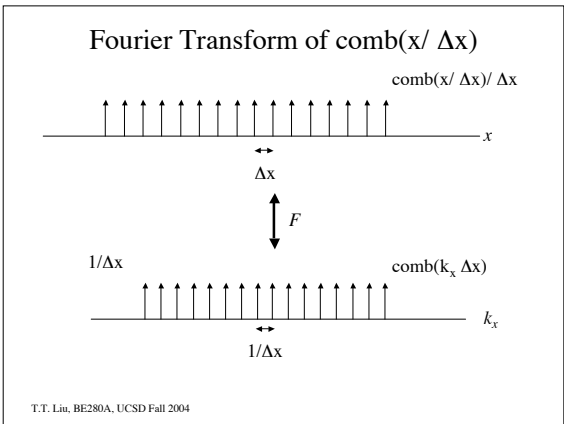
Fourier Transform of $g_S(x)$

$$F\left[g_S(x)\right] = F\left[g(x)\frac{1}{\Delta x}comb\left(\frac{x}{\Delta x}\right)\right]$$

$$= G(k_x) * F\left[\frac{1}{\Delta x}comb\left(\frac{x}{\Delta x}\right)\right]$$

$$= G(k_x) * \frac{1}{\Delta x}\sum_{n=-\infty}^{\infty}\delta\left(k_x - \frac{n}{\Delta x}\right)$$

$$= \frac{1}{\Delta x}\sum_{n=-\infty}^{\infty}G(k_x) * \delta\left(k_x - \frac{n}{\Delta x}\right)$$

$$= \frac{1}{\Delta x}\sum_{n=-\infty}^{\infty}G\left(k_x - \frac{n}{\Delta x}\right)$$
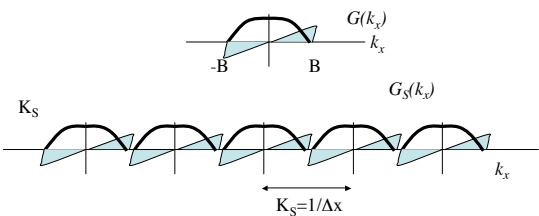
Fourier Transform of $g_S(x)$
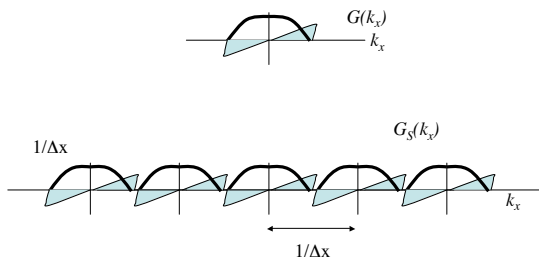
Nyquist Condition

To avoid overlap, we require that $1/\Delta x > 2B$ or
$K_S > 2B$ where $K_S = 1/\Delta x$ is the sampling frequency

Reconstruction from Samples

K_S

$G_S(k_x)$

$K_S = 1/\Delta x$

Multiply by
$(1/K_S)rect(k_x/K_S)$

$(1/K_S)\, G_S(k_x)\mathrm{rect}(k_x/K_S)$
$= G(k_x)$

Reconstruction from Samples

If the Nyquist condition is met, then

$$\hat{G}_S(k_x) = \frac{1}{K_S} G_S(k_x) rect(k_x/K_S) = G(k_x)$$

And the signal can be reconstructed by convolving the sample with a sinc function

$$\hat{g}_S(x) = g_S(x) * \sin c(K_s x)$$
$$= \sum_{n=-\infty}^{\infty} g(n\Delta X)\delta(x - n\Delta X) * \sin c(K_s x)$$
$$= \sum_{n=-\infty}^{\infty} g(n\Delta X)\sin c(K_s(x - n\Delta x))$$

Example Cosine Reconstruction

$cos(2\pi k_0 x)$

$-k_0$ k_0

$K_S > 2k_0$

$-k_0$ k_0

K_S

$K_S = 2k_0$

$-k_0$ k_0

K_S

7
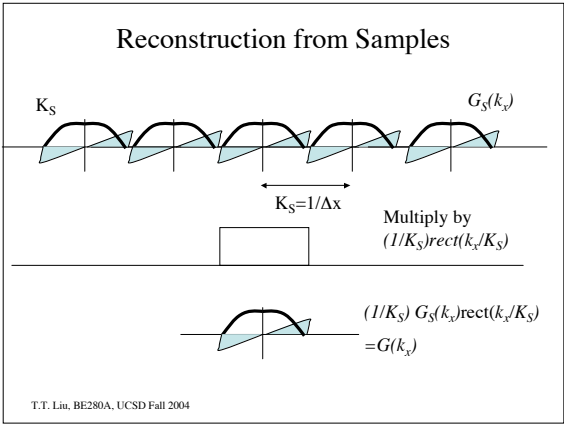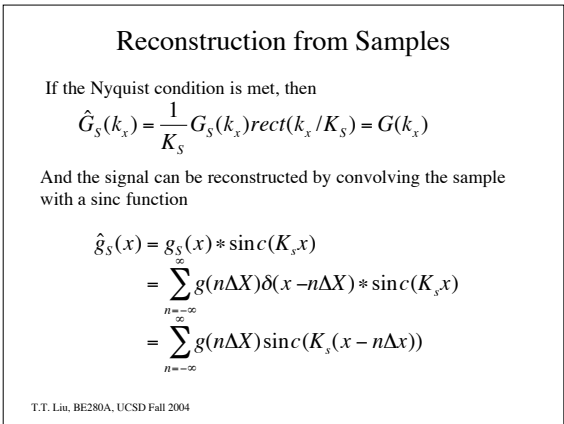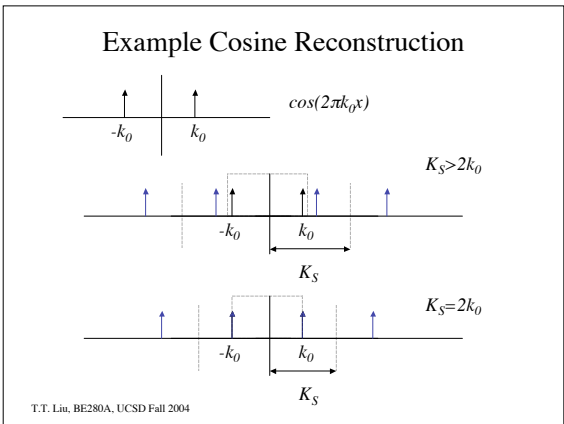
Cosine Example with $K_S=2k_0$
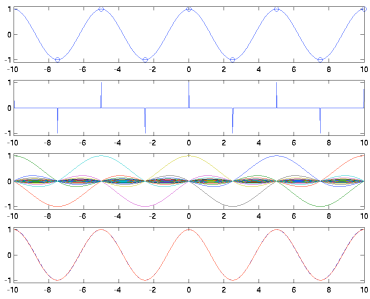
T.T. Liu, BE280A, UCSD Fall 2004

Example with $K_s=4k_0$
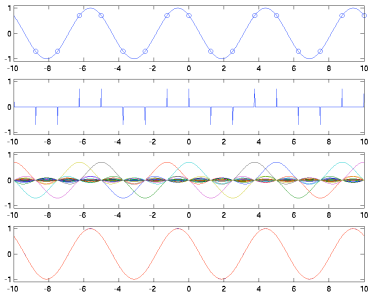
T.T. Liu, BE280A, UCSD Fall 2004

Example with $K_s=8k_0$

T.T. Liu, BE280A, UCSD Fall 2004

Sine Example with $K_s = 2k_0$

Example Sine Reconstruction

$2jsin(2\pi k_0 x)$

$-k_0$

k_0

$K_S > 2k_0$

$-k_0$

k_0

K_S

$K_S = 2k_0$

Aliased!

$-k_0$

k_0

K_S

Aliasing

$G(k_x)$

k_x

$-B$

B

K_S

Aliasing occurs when the Nyquist condition is not satisfied.
This occurs for $K_S \leq 2B$

Aliasing Example

Aliasing Example

$cos(2\pi k_0 x)$

$-k_0$ k_0

$K_S = k_0$

$-k_0$ k_0

K_S

Aliasing Example

$cos(2\pi k_0 x)$
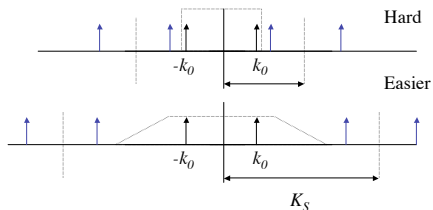
$-k_0$ k_0

$2k_0 > K_S > k_0$

$-k_0$ k_0

K_S
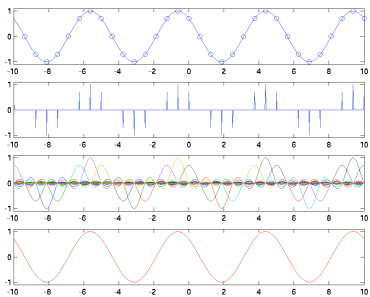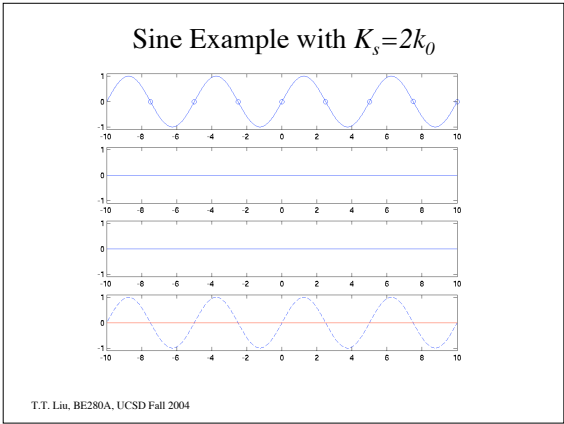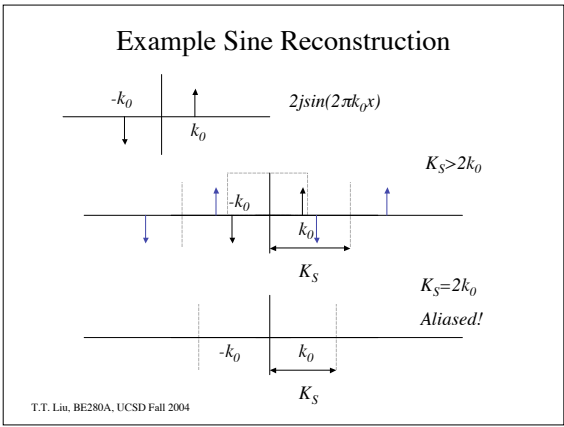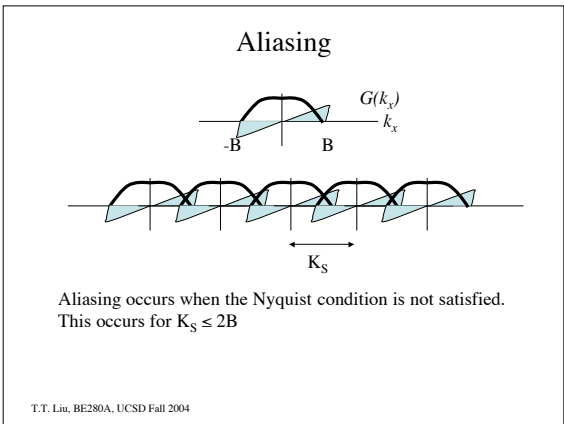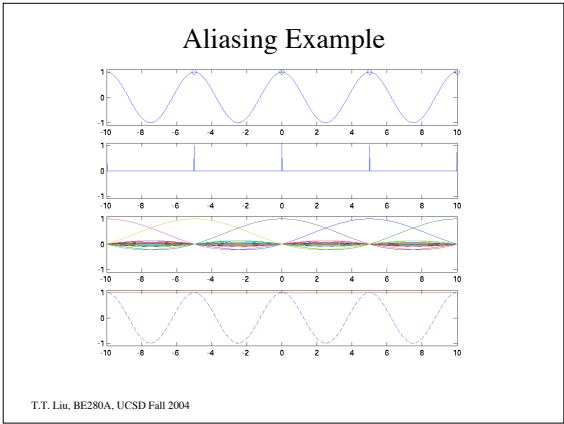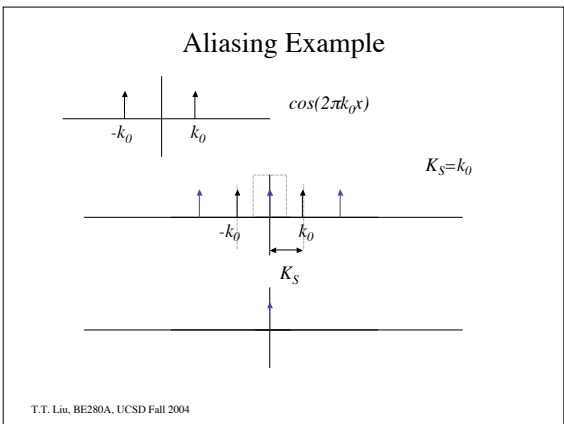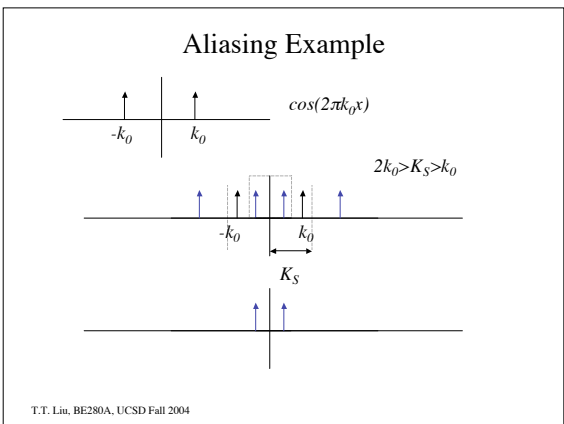
Practical Considerations

Why sample higher than the Nyquist frequency?

-- true sinc interpolation is not practical since the sinc function goes from -infinity to infinity

-- the requirements on the low-pass filter are reduced.
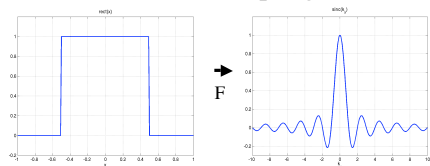
Fourier Sampling

Instead of sampling the signal, we sample its Fourier Transform

Sample

??? ← F^{-1}

Fourier Sampling

$(1/\Delta k_x)\, comb(k_x/\Delta k_x)$

Δk_x

k_x
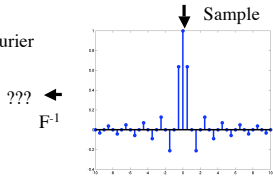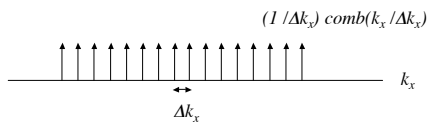
$$G_S(k_x) = G(k_x)\frac{1}{\Delta k_x}comb\left(\frac{k_x}{\Delta k_x}\right)$$

$$= G(k_x)\sum_{n=-\infty}^{\infty}\delta(k_x - n\Delta k_x)$$

$$= \sum_{n=-\infty}^{\infty}G(n\Delta k_x)\delta(k_x - n\Delta k_x)$$

Fourier Sampling -- Inverse Transform

X $\uparrow\uparrow\uparrow\uparrow\uparrow\uparrow\uparrow\uparrow\uparrow\uparrow\uparrow$ =

Δk_x

* $\uparrow \qquad \uparrow \qquad \uparrow \qquad \uparrow$ =

$1/\Delta k_x$
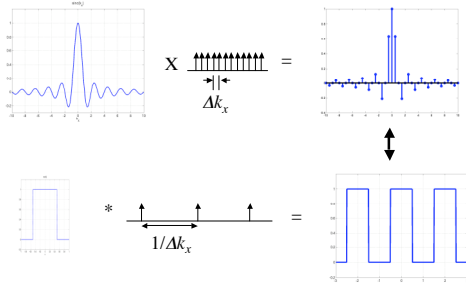
Fourier Sampling -- Inverse Transform

$$g_s(x) = F^{-1}\left[G_s(k_x)\right]$$

$$= F^{-1}\left[G(k_x)\frac{1}{\Delta k_x}comb\left(\frac{k_x}{\Delta k_x}\right)\right]$$

$$= F^{-1}\left[G(k_x)\right] * F^{-1}\left[\frac{1}{\Delta k_x}comb\left(\frac{k_x}{\Delta k_x}\right)\right]$$

$$= g(x) * comb\left(x\Delta k_x\right)$$

$$= g(x) * \sum_{n=-\infty}^{\infty}\delta(x\Delta k_x - n)$$

$$= g(x) * \frac{1}{\Delta k_x}\sum_{n=-\infty}^{\infty}\delta(x - \frac{n}{\Delta k_x})$$

$$= \frac{1}{\Delta k_x}\sum_{n=-\infty}^{\infty}g(x - \frac{n}{\Delta k_x})$$

Nyquist Condition

FOV (Field of View)

$1/\Delta k_x$
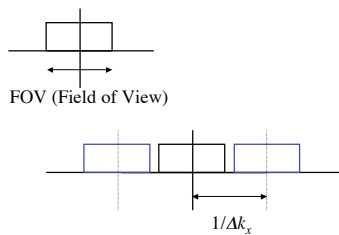
To avoid overlap, $1/\Delta k_x >$ FOV, or equivalently, $\Delta k_x < 1/$FOV

Aliasing

FOV (Field of View)

$1/\Delta k_x$
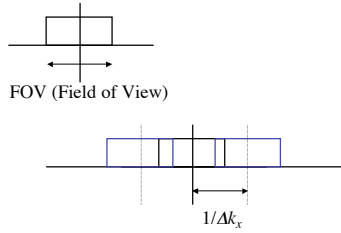
Aliasing occurs when $1/\Delta k_x <$ FOV
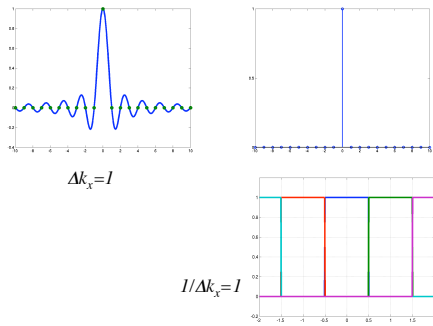
Aliasing Example

$\Delta k_x = 1$

$1/\Delta k_x = 1$

2D Comb Function

$$comb(x,y) = \sum_{m=-\infty}^{\infty} \sum_{n=-\infty}^{\infty} \delta(x-m, y-n)$$
$$= \sum_{m=-\infty}^{\infty} \sum_{n=-\infty}^{\infty} \delta(x-m)\delta(y-n)$$
$$= comb(x)comb(y)$$
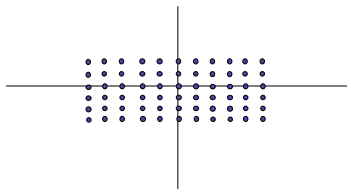
Scaled 2D Comb Function

$$comb(x/\Delta x, y/\Delta y) = comb(x/\Delta x)comb(y/\Delta y)$$

$$= \Delta x \Delta y \sum_{m=-\infty}^{\infty} \sum_{n=-\infty}^{\infty} \delta(x - m\Delta x)\delta(y - n\Delta y)$$
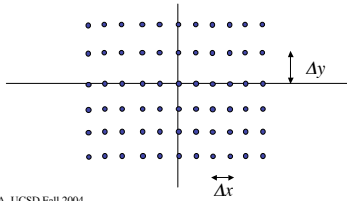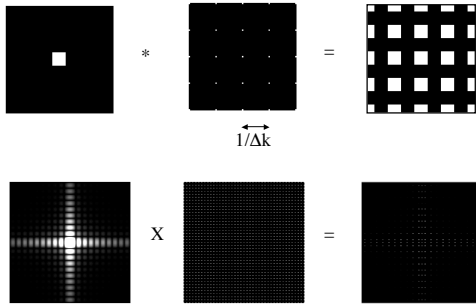
2D k-space sampling

$$G_S(k_x, k_y) = G(k_x, k_y) \frac{1}{\Delta k_x \Delta k_y} comb\left(\frac{k_x}{\Delta k_x}, \frac{k_y}{\Delta k_y}\right)$$

$$= G(k_x, k_y) \sum_{m=-\infty}^{\infty} \sum_{n=-\infty}^{\infty} \delta(k_x - m\Delta k_x, k_y - n\Delta k_y)$$

$$= \sum_{m=-\infty}^{\infty} \sum_{n=-\infty}^{\infty} G(m\Delta k_x, n\Delta k_y)\delta(k_x - m\Delta k_x, k_y - n\Delta k_y)$$

2D k-space sampling

$$g_s(x,y) = F^{-1}\left[G_S(k_x,k_y)\right]$$

$$= F^{-1}\left[G(k_x,k_y)\frac{1}{\Delta k_x \Delta k_y}comb\left(\frac{k_x}{\Delta k_x},\frac{k_y}{\Delta k_y}\right)\right]$$

$$= F^{-1}\left[G(k_x,k_y)\right]*F^{-1}\left[\frac{1}{\Delta k_x \Delta k_y}comb\left(\frac{k_x}{\Delta k_x},\frac{k_y}{\Delta k_y}\right)\right]$$

$$= g(x,y)**comb\left(x\Delta k_x\right)comb\left(y\Delta k_y\right)$$

$$= g(x)**\sum_{m=-\infty}^{\infty}\sum_{n=-\infty}^{\infty}\delta(x\Delta k_x - m)\delta(y\Delta k_y - n)$$

$$= g(x)**\frac{1}{\Delta k_x \Delta k_y}\sum_{m=-\infty}^{\infty}\sum_{n=-\infty}^{\infty}\delta(x-\frac{m}{\Delta k_x})\delta(y-\frac{n}{\Delta k_y})$$

$$= \frac{1}{\Delta k_x \Delta k_y}\sum_{m=-\infty}^{\infty}\sum_{n=-\infty}^{\infty}g(x-\frac{m}{\Delta k_x},y-\frac{n}{\Delta k_y})$$

Nyquist Conditions

$1/\Delta k_Y > FOV_Y$

$1/\Delta k_X > FOV_X$

$1/\Delta k_Y$

FOV_Y

FOV_X $1/\Delta k_X$

Aliasing